

Sheridan County Brooks Street Greenspace

224 South Main Street
Sheridan, WY 82801
Job# : 6017.002.00

WEATHER

Time	Temp	Hum	W-Dir	W-Speed	W-Gust	Precip	Condition
09:25 AM	43 °F	33%	WSW	22 MPH		0 IN	Windy
01:10 PM	48 °F	27%	WSW	18 MPH		0 IN	
05:25 PM	48 °F	23%	W	16 MPH		0 IN	
07:10 PM	46 °F	24%	WSW	15 MPH		0 IN	

WATER SERVICE

10:10 AM **Tre LaBossiere**
[Lat/Long: 44.795340,-106.957114]

Arrived on site at 10:00.
Northern Underground was on site for the initial flushing and chlorinating of the water line. Northern Underground was flowing the water into their water truck as to not flood the Brooks and Burkitt intersection. There were no issues with the flushing and chlorination. Northern Underground could not get their water line to hold 150+ psi (200psi required) and I told them to let me know when they could get their line to hold and I would be back to witness the pressure test.

More information will be included in the water testing report.





02:55 PM **Tre LaBossiere**

[Lat/Long: 44.795281,-106.957162]

Arrived on site at 2:40.

Northern Underground was able to pressure the line up to 200 psi, and started the pressure test. Unfortunately, one of NU's operators hid the 90 degree fitting and broke the pipe resulting in all the pressure to do drop. Mat asked if he could reschedule the pressure test for tomorrow.



Employee Signature: *Tim LaBassive*

Sheridan County Brooks Street Greenspace

224 South Main Street
Sheridan, WY 82801
Job# : 6017.002.00

WEATHER

Time	Temp	Hum	W-Dir	W-Speed	W-Gust	Precip	Condition
01:10 AM	48 °F	25%	W	18 MPH		0 IN	
05:25 AM	37 °F	40%	WNW	3 MPH		0 IN	
09:10 AM	39 °F	41%	WNW	7 MPH		0 IN	
05:25 PM	48 °F	31%		0 MPH		0 IN	
09:10 PM	39 °F	41%	WSW	7 MPH		0 IN	

WATER SERVICE


10:32 AM **Tre LaBossiere**
[Lat/Long: 44.795309,-106.957373]

Arrived on site at 9:30.
Norther Underground was on site and trying to get the pressure test set up. NU was struggling to get the pipe to hold together at the end which kept blowing apart.

I recommended NU to allow me to reschedule UM for final flushing for tomorrow since they are struggling with the end blowing apart.

NU was able to get the waterline to hold pressure and initiated a pressure test. While the water line was pressure testing NU was grouting the storm pipes in CI-1

Northern concluded their water test at 2:20. The pressure test passed with an allowable leakage of 15 ozs NU's testing apparatus dropping from 206-199 only leaked 8ozs

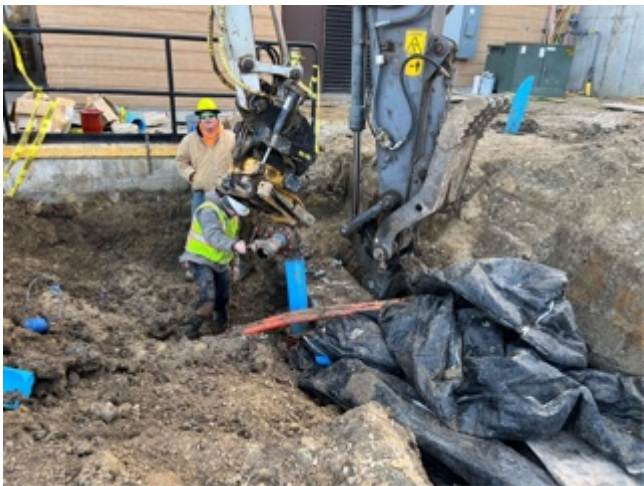

Employee Signature: *Tim LaBassive*

Daily Report

Wednesday, Dec 20, 2023

Sheridan County Brooks Street Greenspace

224 South Main Street
Sheridan, WY 82801
Job# : 6017.002.00

WEATHER

Time	Temp	Hum	W-Dir	W-Speed	W-Gust	Precip	Condition
12:10 AM	39 °F	48%	WSW	6 MPH		0 IN	
05:10 AM	36 °F	59%	WSW	6 MPH		0 IN	
09:55 AM	43 °F	48%		3 MPH		0 IN	
01:25 PM	57 °F	28%	WSW	14 MPH		0 IN	
05:10 PM	50 °F	37%	WSW	11 MPH		0 IN	
09:25 PM	39 °F	55%	WNW	7 MPH		0 IN	

WATER SERVICE

01:36 PM **Tre LaBossiere**
[Lat/Long: 44.786249,-106.948343]

Arrived on site at one for water sampling receiving. More information will be included in the water line testing report.

Employee Signature:

